


PUNTE FISSE per TORNITURA

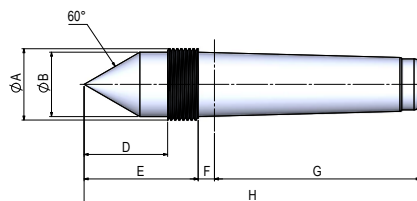


SERIE FG-S / Series FG-S

Punta fissa per tornio CNC / Dead center for CNC lathe

CONO MORSE / Morse Taper	DIMENSIONI / Dimensions (mm)							CHIAVE DI ESTRAZIONE / Removal Key (mm)	GHIERA / Ring Nut (KM)	SERIE / Series	CODICE / Code	€
	ØA	ØB	D	E	F	G	H					
C.M.3	M30x1,5	24	35	50	5	81	136	21	6	FG3/S	RFS003.000.17	170,00
C.M.4	M35x1,5	31,5	41	56	6,5	102,5	165	28	7	FG4/S	RFS004.000.17	200,00
C.M.5	M50x1,5	44	65	80	6,5	129,5	216	40	10	FG5/S	RFS005.000.17	250,00
C.M.6	M70x2	64	80,5	95,5	8	182	285,5	60	14	FG6/S	RFS006.000.17	520,00
ME80	M85x1,5	80,4	104,6	125,6	8	196	329,5	75	17	FG80/S	RFS080.000.17	1500,00
ME100	M105x2	100,5	122	143	10	232	385	95	21	FG100/S	RFS100.000.17	1750,00


ME80 e ME100 con punta troncata Ø10 / ME80 and ME100 with Ø10 cut off point

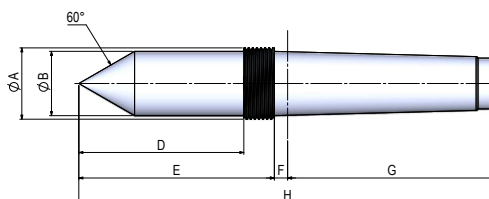

SERIE FGL-S / Series FGL-S

Punta fissa lunga per tornio CNC / Extended dead center for CNC lathe

CONO MORSE / Morse Taper	DIMENSIONI / Dimensions (mm)							CHIAVE DI ESTRAZIONE / Removal Key (mm)	GHIERA / Ring Nut (KM)	SERIE / Series	CODICE / Code	€
	ØA	ØB	D	E	F	G	H					
C.M.3	M30x1,5	24	70	85	5	81	171	21	6	FGL3/S	RFS003.000.26	245,00
C.M.4	M35x1,5	31,5	81	96	6,5	102,5	205	28	7	FGL4/S	RFS004.000.06	250,00
C.M.5	M50x1,5	44	105	120	6,5	129,5	256	40	10	FGL5/S	RFS005.000.27	280,00
C.M.6	M70x2	64	110,5	125,5	8	182	315,5	60	14	FGL6/S	RFS006.000.02	500,00

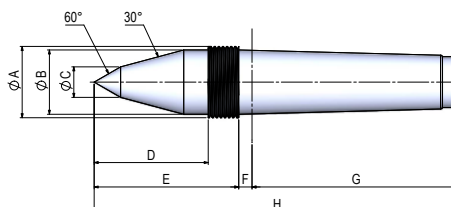


SERIE FG-T / Series FG-T

Punta fissa per tornio CNC / Dead center for CNC lathe

CONO MORSE / Morse Taper	DIMENSIONI / Dimensions (mm)							CHIAVE DI ESTRAZIONE / Removal Key (mm)	GHIERA / Ring Nut (KM)	SERIE / Series	CODICE / Code	€	
	ØA	ØB	ØC	D	E	F	G						H
C.M.3	M30x1,5	24	12	47	62	5	81	148	21	6	FG3/T	RFS003.000.20	255,00
C.M.4	M35x1,5	31,5	15	56	71	6,5	102,5	180	28	7	FG4/T	RFS004.000.20	260,00
C.M.5	M50x1,5	44	18	80	95	6,5	129,5	231	40	10	FG5/T	RFS005.000.20	270,00
C.M.6	M70x2	64	20	124,4	139,4	8	182	329,4	60	14	FG6/T	RFS006.000.20	560,00

PUNTE FISSE per TORNITURA

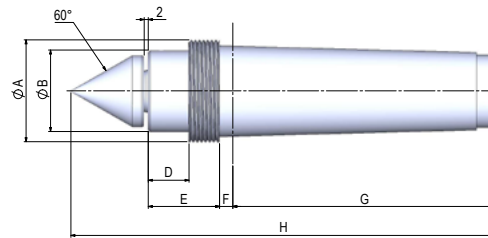


SERIE FG-FS / Series FG-FS

Punta fissa per tornio CNC con cuspidi intercambiabile / Dead center for CNC lathe with interchangeable point

CONO MORSE / Morse Taper	DIMENSIONI / Dimensions (mm)							CHIAVE DI ESTRAZIONE / Removal Key (mm)	GHIERA / Ring Nut (KM)	SERIE / Series	CODICE / Code	€
	ØA	ØB	D	E	F	G	H					
C.M.3	M30x1,5	26	20	35	5	81	121	21	6	FG3/FS	RFS003.000.18	370,00
C.M.4	M35x1,5	32	20	35	6,5	102,5	144	28	7	FG4/FS	RFS004.000.18	395,00
C.M.5	M50x1,5	40	20	35	6,5	129,5	171	40	10	FG5/FS	RFS005.000.18	410,00

Cuspidi intercambiabili a pag. 13 / For interchangeable points see page n.13

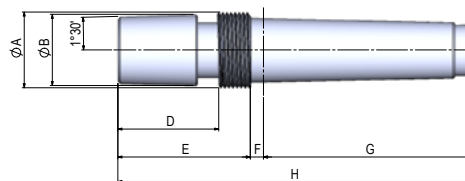

SERIE FG-F / Series FG-F

Punta fissa per tornio CNC con cuspidi porta flangia / Dead center for CNC lathe with point for flange

CONO MORSE / Morse Taper	DIMENSIONI / Dimensions (mm)							CHIAVE DI ESTRAZIONE / Removal Key (mm)	GHIERA / Ring Nut (KM)	SERIE / Series	CODICE / Code	€
	ØA	ØB	D	E	F	G	H					
C.M.3	M30x1,5	35	50	65	5	81	151	21	6	FG3/F	RFS003.000.21	240,00
C.M.4	M35x1,5	35	50	65	6,5	102,5	174	28	7	FG4/F	RFS004.000.21	250,00
C.M.5	M50x1,5	35	50	65	6,5	129,5	231	40	10	FG5/F	RFS005.000.21	295,00
C.M.6	M70x2	35	50	65	8	182	255	60	14	FG6/F	RFS006.000.21	440,00

Flange intercambiabili a pag. 14 / For interchangeable flanges see page n.14